SIEMENS

UROSKOP D

CS

Service Instructions SP007/02/R

Title: Cover for Cassette Carriage

Reason for update:

	[X] Reliability	[ ] Infrequent Service
Urgency:	[ ] Immediate	[x] Within 12 months
Update materials required?	[x] Yes	[ ] No
Materials free of charge?	[ ] Yes	[x] No
Return of parts?	[ ] Yes	[x] No
Estimated completion time:	0,5 h	Number of CSE's: 1 person
Customer Information?	[ ] Yes	[x] No

Systems/Products affected/System identifying IVK

Name	Part No.	Serial No.
UROSKOP D1	97 85 023 G5354	n.a.
UROSKOP D2 / D3	97 85 015 G5354	n.a.

Remark: n.a.

Components affected/to be modified/IVK

Name	Part No.	Serial No.	Component status	
			affected	not affected
n.a.	n.a.	n.a.	n.a.	n.a.

Remark: n.a.

Chg. Rev. No.: 116 871
Name: Erlwein
Dept.: CS PS 24

© Siemens AG 2002
The reproduction, transmission or use of this document or its contents is not permitted without express written authority. Offenders will be liable for damages. All rights, including rights created by patent grant or registration of a utility model or design, are reserved.

Document revision level

The document corresponds to the version/revision level effective at the time of system delivery. Revisions to hardcopy documentation are not automatically distributed.

Please contact your local Siemens office to order current revision levels.

Disclaimer

The installation and service of equipment described herein is to be performed by qualified personnel who are employed by Siemens or one of its affiliates or who are otherwise authorized by Siemens or one of its affiliates to provide such services.

Assemblers and other persons who are not employed by or otherwise directly affiliated with or authorized by Siemens or one of its affiliates are directed to contact one of the local offices of Siemens or one of its affiliates before attempting installation or service procedures.

Systems/Products affected

All UROSKOP D systems

Reason for the Update

Fluids can penetrate the plastic cover of the cassette carriage of the UROSKOP D and cause rust.

Prerequisites

n.a.

Special Tools / Documents

n.a.

Ordering Information

Place an order as follows for each system to be updated:

20 49 716 Sealing compound

Returns

n.a.

Spare Parts Handling

n.a.

Work Steps

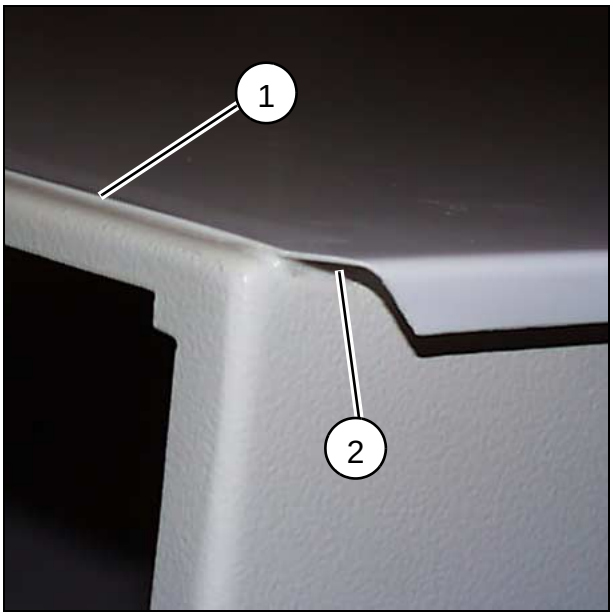

Fig. 1

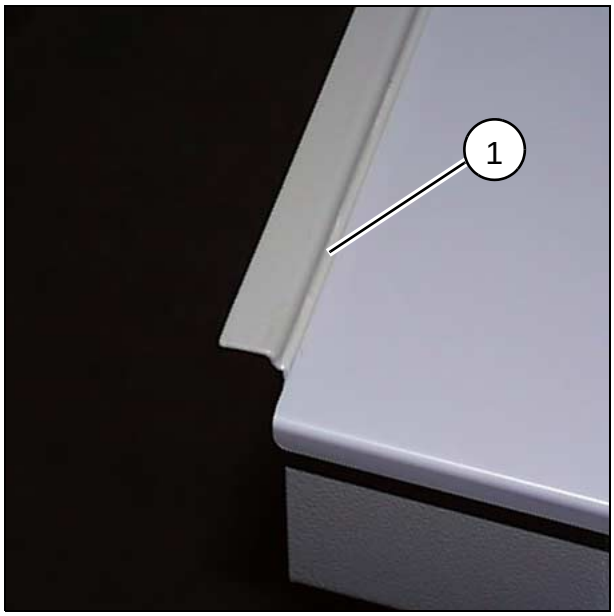

Fig. 2

- Unscrew the cover of the cassette carriage and pull it out to the front.
- The gap between the plastic cover and the metal frame (1/Fig.1) must be sealed with sealing material. Smooth out the sealing material and remove the residues.
- Also apply the sealing material along all sides underneath the protruding plastic cover (2/Fig.1).
- Seal the gap (1/Fig. 2) at the back of the cover as well.
- Reinstall the cover.

Final Check

n.a.

Customer Information

n.a.

Final Work Steps

- Update the system documentation.
  Update the Revision level, the User Instructions and the technical documentation.
  Fill out, and if needed, copy the attached "Update Completion Form" and insert it into Register 10 of the System Binder or System Logbook.
- Updates that were completed prior to publication of this SI must also be reported.
- The update is reported as follows:
  - The modification reply report has to be made exclusively through an application in the Intranet by authorized persons. Do not send the update completion from to CSPS.

Changes to Previous Version

n.a.

Completion Protocol

The update with the number **SP007/02/R** has been completed.

Part Number: ..... Model No: .....

Serial Number: ..... SKZ: .....

Customer: ..... Site: .....

Customer No.: .....

Name (CSE): ..... Telephone: .....

Country: ..... Location: .....

Date: ..... Signature: .....

Remark: .....

.....

NOTICE

After completing the update, make a copy of this page, fill it out and file it in Register 10 of the System Manual at the corresponding site.